

**STANDARD ARRIVAL CHART**  
**RNAV (GNSS) -**  
**INSTRUMENT (STAR)**

ACC 134.4  
 APP 124.05 / 120.3  
 ARR 119.3  
 TWR 118.6 / 118.25

TRANSITION ALTITUDE  
 11 000ft

D-ATIS AP ID-WSSS  
 128.6

**SINGAPORE/Singapore Changi**  
**RWY 02L/C**  
**OBDOS ONE ALPHA ARRIVAL**  
**OBDOS 1A**



**ELEV, ALT IN FEET**  
 BEARINGS, TRACKS AND  
 RADIALS ARE MAGNETIC  
 VAR 26°E (2015)

DISTANCES IN NM

**NOTE:** RADAR REQUIRED

**NOTE:** RNAV-1 NAVIGATION SPECIFICATION GNSS REQUIRED

**NOTE:** REFER TO BACK PAGE FOR  
 - FORMAL AND TABULAR DESCRIPTIONS  
 - RADIO COM FAILURE PROCEDURES

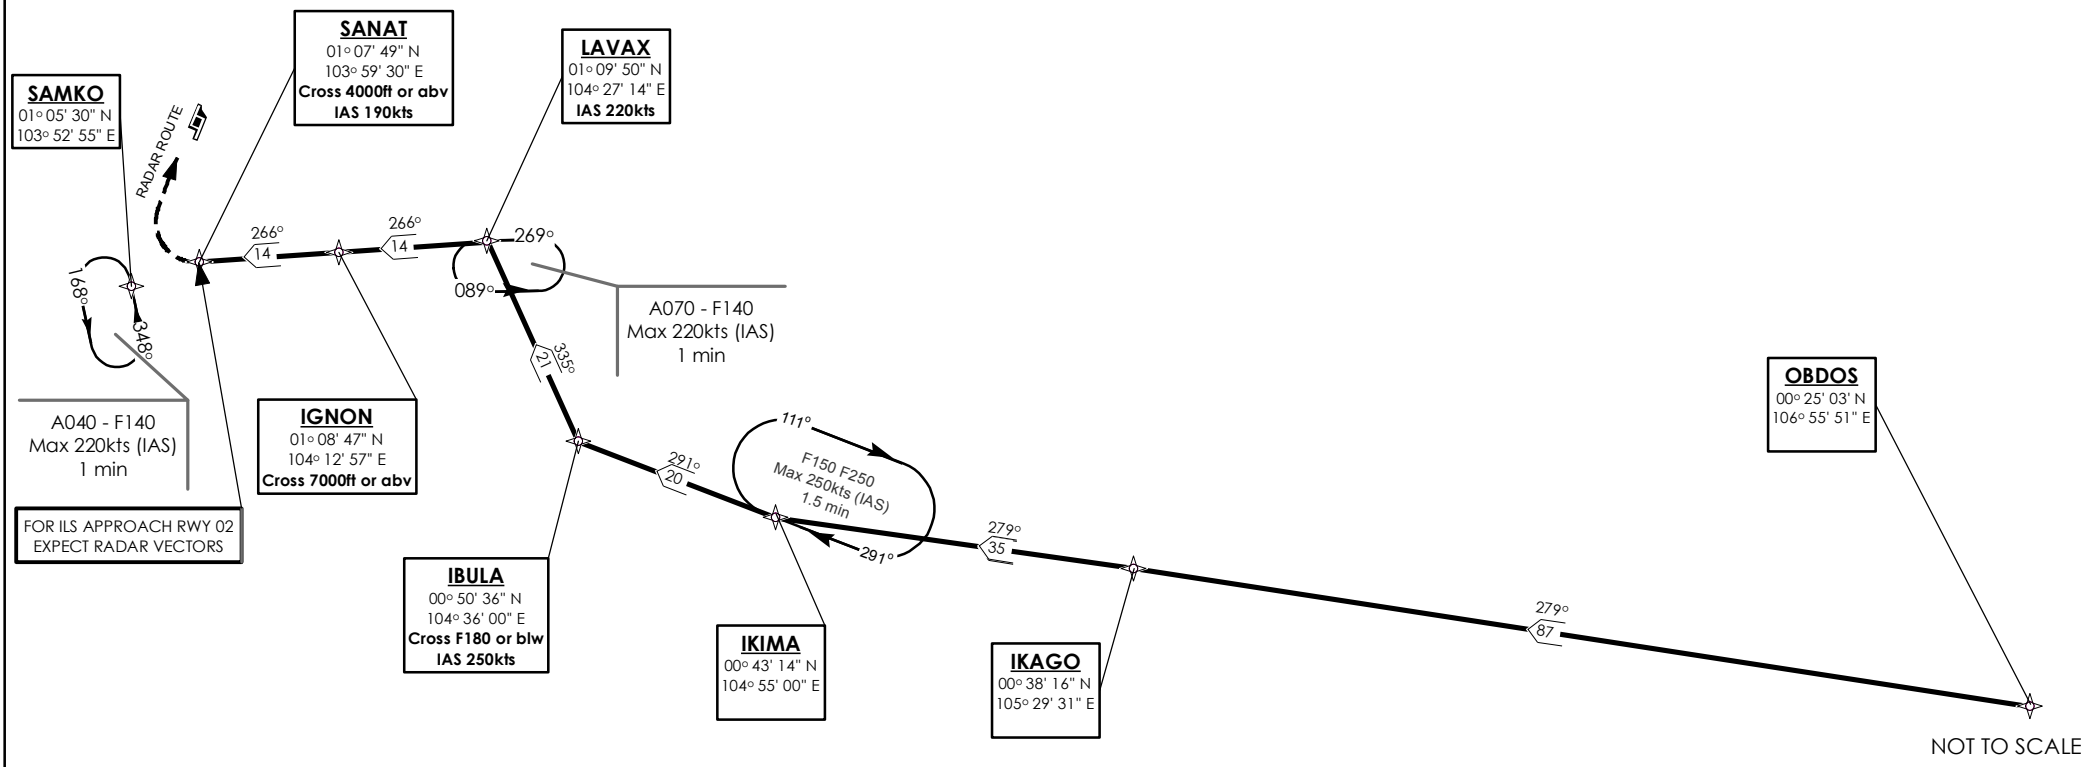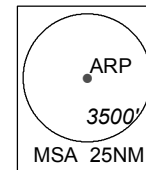

**OBDOS 1A (STAR) RNAV GNSS RWY 02L/02C - DESCRIPTIONS**

**Formal & Abbreviated Descriptions**

Formal Description	Abbreviated Description	Path Terminator	Fly-Over required
From OBDOS. To IKAGO. To IKIMA, turn right. To IBULA at or below FL180, speed 250kts, turn right. To LAVAX, speed 220kts, turn left. To IGNON at or above 7000ft. To SANAT at or above 4000ft, speed 190kts.	OBDOS -	IF	N
	IKAGO -	TF	N
	IKIMA [R] -	TF	N
	IBULA [FL180-; K250; R] -	TF	N
	LAVAX [K220; L] -	TF	N
	IGNON [A070+] -	TF	N
	SANAT [A040+; K190]	TF	N

**Tabular Descriptions**

Path Term	Waypoint Name	Fly-Over	Course °M(°T)	Magnetic Variation	Turn Direction	Altitude	Speed Limit	Navigation Spec
IF	OBDOS	-	-	-0.5	-	-	-	RNAV1
TF	IKAGO	-	279(279.5)	-0.5	-	-	-	RNAV1
TF	IKIMA	-	279(279.5)	-0.5	R	-	-	RNAV1
TF	IBULA	-	291(291.1)	-0.5	R	FL180-	K250	RNAV1
TF	LAVAX	-	335(335.4)	-0.5	L	-	K220	RNAV1
TF	IGNON	-	266(266.5)	-0.5	-	A070+	-	RNAV1
TF	SANAT	-	266(266.5)	-0.5	-	A040+	K190	RNAV1

**RADIO COMMUNICATIONS FAILURE PROCEDURE**

<b>1</b>	<b>SET TRANSPONDER TO MODE A/C CODE 7600</b>
<b>2</b>	<p><b>When cleared via OBDOS 1A by Singapore ATC</b></p> <p>(a) Maintain last assigned flight level or altitude and proceed on OBDOS 1A to SANAT, then direct to SAMKO</p> <p>(b) From SAMKO commence descent and carry out appropriate landing procedure for RWY 02 as close as possible to EAT or ETA</p> <p>(c) If unable to effect a landing, refer to Singapore AIP for missed approach procedure</p>
<b>3</b>	<p><b>No clearance or instruction received from Singapore ATC</b></p> <p>- Refer to Singapore AIP for radio communications failure procedure</p>